

Manhole Inspection Summary

Manhole # S06AA_002MH

Printed On: 6/24/2010

Page 1 of 3

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **06AA** Node: **002** Status: **Found**

Insp Date: **4/14/08 7:31 AM**

Incomplete Comments

Crew: **RL SD**
Inspector: **Johnson**
Firm: **URS**

Location Address: **FRANKLINTOWN BLVD**

Cross Street: **ROW ALONG SIDE
GWYNNS FALLS**

Manhole Type: **Inline** Location: **Easement / Right
of Way** Ground Conditions: **Dry**

☒ Prev. Rehab Weather: **Dry** Subject To Ponding: **None**

Comments **3 GPM ACTIVE INFILTRATION FROM BENCH**

Cover Shape: **Circular** Diameter: **26** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary** Condition: **Sound** Cover Material: **Cast Iron**

Properties: ☒ Bolted ☐ Vented ☐ Water Tight ☒ Water Tight Insert

Frame Offset: **0** (in.) Condition: ☒ Sound ☐ Cracked ☐ Leaks

Chimney / Frame Adjustment ☐ Exists Material: **Unknown** ☐ Parged Height: **8** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Corbel Material: **Concrete** ☒ Parged Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Barrel Material: **Concrete** ☒ Parged

Shape: **Circular** Diameter: **48** (in.) Length: (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Bench ☒ Exists Material: **Concrete** ☒ Parged

Condition: ☐ Sound ☒ **Cracked** ☐ Root Intrusion ☐ Deteriorated ☒ **Leaks** ☐ Debris

Channel Material: **Brick** ☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Steps Count: **3** Missing: **0** ☐ Corroded

Surcharge ☐ Evidence Of Surcharge Depth: (ft.) ☐ Active Surcharge Present

Location View




Top View



FRAME SEAL GASKET



Defect 1

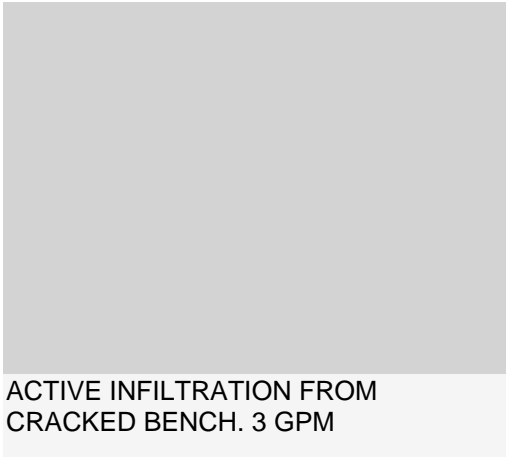

ACTIVE INFILTRATION FROM
CRACKED BENCH. 3 GPM

Manhole Inspection Summary

Manhole # S06AA_002MH

Printed On: 6/24/2010

Page 3 of 3

21 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



ACTIVE INFILTRATION FROM BENCH AT 9 O'CLOCK

Pipe Height: **21.6** (in.) Rod and Bar (Angled)

Pipe Material: **Concrete** ☐ Pipe Lined

Invert Depth: **8.30** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

 
Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

21 in. Circular Gravity Sewer
Pipe In @ 6 O'Clock

6 O'Clock Inflow



Pipe Height: **21.6** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☒ Pipe Lined

Invert Depth: **8.10** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection